


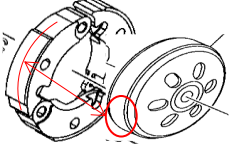
TROUBLE SHOOTING GUIDE

TSG-2020-0004

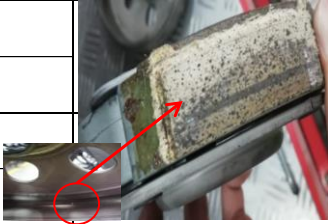
DATE	28/11/2020	ISSUE BY	zaidi	CHECK BY	Rashid	APP.BY	Mazmin
MODEL	All bike	PROBLEM	Engine noise at CVT Area				
SYMPTOM	bike vibration when accelerate from idling to mid speed						

PHOTO





surface uneven at clutch housing

ITEMS		DESCRIPTION	PHOTO
Check Point	Step 1	Check rear wheel and tire condition	
	Step 2	Check engine oil and gear oil condition and level	
	Step 3	Check CVT area - check and open cover CVT	
	Step 4	Check front and rear secondary sheave	
Problem Finding	Step 1	Rear clutch carrier comp surface lining shoe NG clutch housing surface point NG	
	Step 2		
Action Taken	Step 1	Replace the clutch carrier and clutch housing.	
	Step 2		
Test Result	1	Problem solved.	
	2	Tested -ok-	
	3		